PHOENIX


Features and Benefits

- Magnetic technology offers robust performance.
- 100% Non-contacting design (no bearings or bushings) provides an extremely long life expectancy and is tolerant to harsh environments.
- Simple two piece design (target magnet + encoder) for easy alignment and installation.
- Output options:Two channel (AB), Two channel with index (ABZ), Differential (AB) outputs, and Differential outputs with index (ABZ)
- Mounting holes for a 2-bolt pattern 1.280 inch BHC x 0.125 inch O.D.
- Target magnet for standard shaft sizes from 2 mm to 1/2 inch. Custom bore sizes available.
- Optional universal target magnet hub to accomodate both metric (2, 4, 5, 6 & 8mm) and inch (1/8, 3/16, 1/4, 5/16 & 3/8 In.) shaft diameters
- Options for 32 2560 pulse per channel per revolution.
- Customizable lead wires, cables, and/or connectors.


Application Example



Kit - Encoder with Target Magnet Shown with shaft pass through hole and single ended wiring Wire color order varies with part configuration

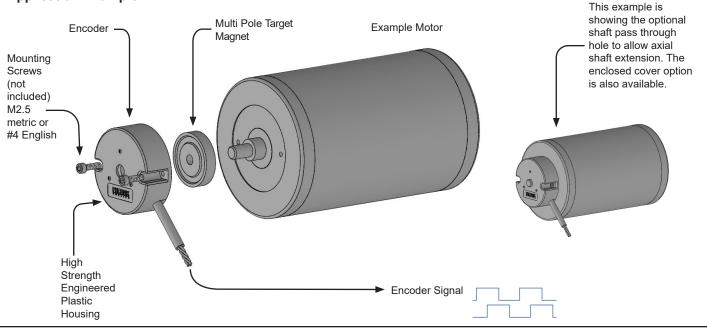

Electrical Circuit

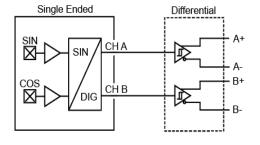

Phoenix America, LLC 4717 Clubview Drive Fort Wayne, IN 46804 T: Within USA: 1 888 801 1422 Outside USA: +1 260 432 9664 www.phoenixamerica.com sales@phoenixamerica.com © Copywrite PAL 2023, PDS DK 05/23

Page 1

Subject to change without notice



Absolute Maximum Ratings

Table 2.1


Characteristic	Symbol	Rating	Units
Forward Supply Voltage	V _{cc}	12	V
Reverse Supply Voltage	V _{RCC}	-0.3	V
Storage Temperature	Τ _s	150	°C
ESD (HMB, 100pF/1.5Kohm)		2	kV
Operating Temperature		-40 to 125	°C


Electrical Specifications - (Vcc = 5V, Ambient Temperature = 23°C)

|--|

Characteristic	Symbol	Min.	Тур.	Max.	Unit
Supply Voltage	V _{cc}	3.3	5	6	V
Supply Current	I _{cc}	-	14	20	mA
Duty Cycle	-	40	50	60	%
Phase	-	70	90	110	°e
Output Frequency	f _{out}	-	-	42	kHz

Output Waveforms

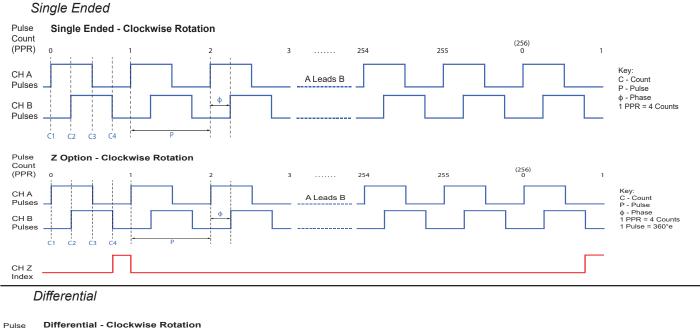

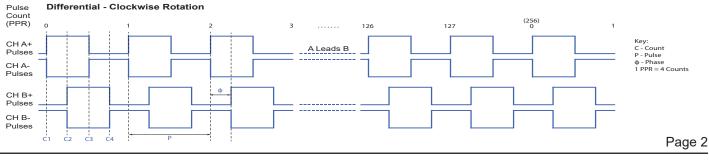



Phoenix America, LLC 4717 Clubview Drive Fort Wayne, IN 46804 T: Within USA: 1 888 801 1422 Outside USA: +1 260 432 9664 www.phoenixamerica.com sales@phoenixamerica.com © Copywrite PAL 2023, PDS DK 05/23



Output Waveforms (Continued)

Differential -Z Option

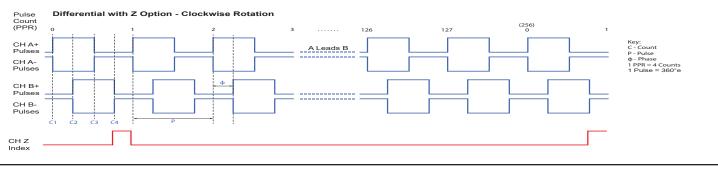


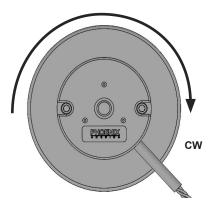

Channel A leads Channel B for clockwise rotation (Shaft rotation is defined when looking at the branded face of the encoder)

Encoder Physical Outline

Cable Version with Strain Relief

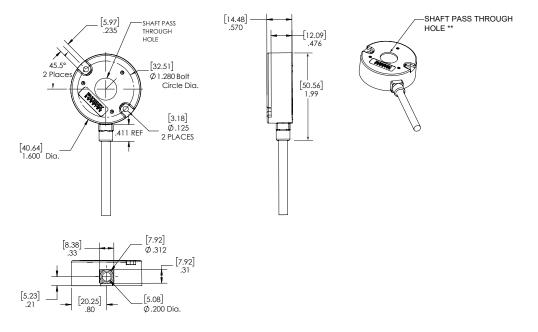

Phoenix America, LLC 4717 Clubview Drive Fort Wayne, IN 46804 T: Within USA: 1 888 801 1422 Outside USA: +1 260 432 9664 www.phoenixamerica.com sales@phoenixamerica.com © Copywrite PAL 2023, PDS DK 05/23

Page 3

Subject to change without notice



Encoder Physical Outline

Flying Lead Version with Strain

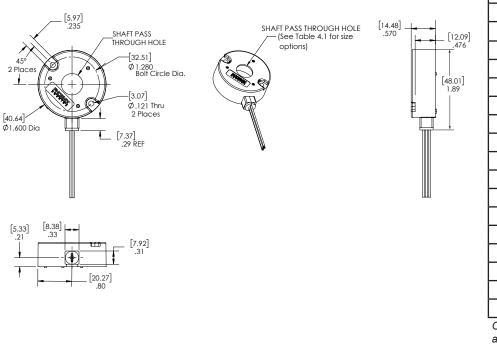



Table 4.1				
Motor Shaft Diameter	Shaft Pass Through Hole Size (options/ recommendation)			
-	No ł	Hole		
2 mm	2.06 mm	0.081 in		
3 mm	3.06 mm	0.120 in		
1/8 in	3.26 mm	0.127 in		
5/32 in	4.06 mm	0.160 in		
4 mm	4.06 mm	0.160 in		
3/16 in	4.83 mm	0.190 in		
5 mm	5.06 mm	0.199 in		
6 mm	6.06 mm	0.239 in		
1/4 in	6.40 mm	0.252 in		
7 mm	7.06 mm	0.278 in		
5/16 in	8.05 mm	0.317 in		
8 mm	8.05 mm	0.317 in		
3/8 in	9.59 mm	0.378 in		
10 mm	10.06 mm	0.396 in		
12 mm	12.06 mm	0.475 in		
1/2 in	12.76 mm	0.502 in		

Other shaft pass through hole sizes available upon request. Contact sales@phoenixamerica.com.

Encoder Mounting Guidelines

Concentricity of the encoder housing to the target magnet is critical for optimal encoder performance. Considering the following during the design phase will ensure concentricity and ease of assembly.

- Tight molding tolerances allow for the outside diameter of the encoder to be used to locate the encoder housing concentric to the motor shaft and target magnet. A machined pocket on the motor endbell works well for alignment. Recommended pocket is 0.015" to 0.020" deep and 2.11" in diameter.
- Extending the shaft through the optional shaft pass through hole is an easy way to align the encoder housing to the motor shaft and target magnet. Simply position the encoder so that the shaft is centered concentrically in the shaft pass through hole.
- If previous two methods of alignment are not used it is recommended that the encoder be fastened to the motor using #5-40 or M3 mounting screws. The slightly larger diameter of the #5-40 and M3 screws will compensate for some of the tolerance allowed when using the standard recommended #4-40 or M2.5 mounting screws.

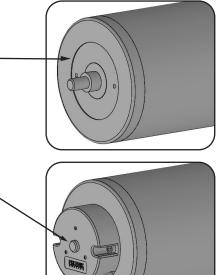

Phoenix America, LLC 4717 Clubview Drive Fort Wayne, IN 46804 T: Within USA: 1 888 801 1422 Outside USA: +1 260 432 9664 www.phoenixamerica.com sales@phoenixamerica.com © Copywrite PAL 2023, PDS DK 05/23

Page 4

Subject to change without notice



Target Magnet Physical Outline - Molded (Mounting Style A)

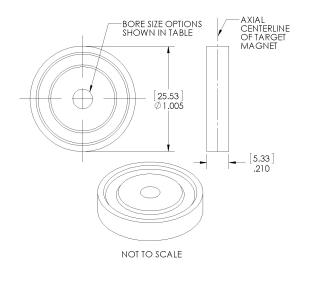


Table 5.	1			
Bore Size (.inch)	Motor Shaft OD Size (nominal)	NEMA Guide Shaft Tolerance	Magnet Bore MIN. (inch)	Magnet Bore MAX. (inch)
079	2 mm (.0787")		.0777	.0807
118	3 mm (.1181")		.1171	.1201
125	1/8 in (.1250")		.1240	.1270
156	5/32 in (.1563")		.1553	.1583
157	4 mm (.1575")		.1565	.1595
188	3/16 in (.1875")	+0.0000"/-0.0005"	.1865	.1895
197	5 mm (.1969")		.1959	.1989
236	6 mm (.2364")		.2354	.2384
250	1/4 in (.2500")		.2490	.2520
276	7 mm (.2758")		.2747	.2777
313	5/16 in (.3125")		.3115	.3145
315	8 mm (.3150")		.3140	.3170
375	3/8 in (.3750")		.3740	.3770
394	10 mm (.3940")		.3930	.3960
473	12 mm (.4728")		.4718	.4748
500	1/2 in (.5000")		.4990	.5020


Other bore sizes available upon request. Contact sales@phoenixamerica.com.

Target Magnet Mounting Guidelines - Molded (Mounting Style A) For Slip Fit Application

• Proper alignment of the target magnet to the encoder sensing element is critical for optimal encoder performance. Insure that the target magnet is mounted to the specified height shown in the diagram below.

Tablo 5 1

- A machined step on the motor shaft provides a quick and repeatable method for positioning the target magnet. Spacers or other fixturing should be used to properly position the target magnet if no mechanical locating features are on the shaft.
- Various adhesives can be used to bond the target magnet to the motor shaft. Shaft alloys, operating environment, and shaft speed and acceleration should be taken into consideration when selecting an appropriate bonding agent. Loctite threadlockers and retaining compounds have proved effective in bonding the target magnet to the motor shaft. Loctite 263 and 2760 threadlockers and Loctite 638 and 680 retaining compounds are good candidates. These materials have been effective in past experience; testing under actual operating conditions should be used to qualify any bonding material.
- For best results, the motor shaft should be clean and free of any oils, lubricants, or solvents.
- Apply adhesive around the leading edge of the shaft and inside the hole in the target magnet. Use a rotating motion when assembling the target magnet to the shaft to insure good adhesive coverage.
- The use of primers and activators can be used to improve bond strength and cure rate.
- For non-critical applications or for fast bonding for evaluation, a cyanoacrylate adhesive (super glue) can be used. Loctite 401 and 410 have proven effective for quick bonding applications.

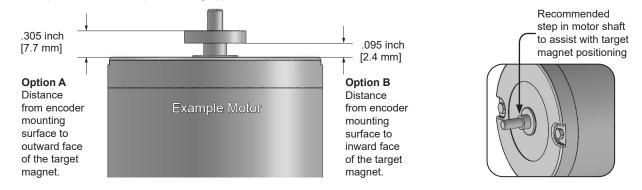

Phoenix America, LLC 4717 Clubview Drive Fort Wayne, IN 46804 T: Within USA: 1 888 801 1422 Outside USA: +1 260 432 9664 www.phoenixamerica.com sales@phoenixamerica.com © Copywrite PAL 2023, PDS DK 05/23

Subject to change without notice

rica.com

Target Magnet Physical Outline - Aluminum Hub (Mounting Style B)


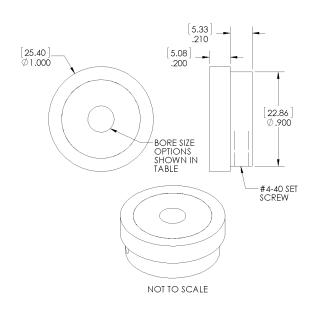


Table 6.	1			
Bore Size (.inch)	Motor Shaft OD Size (nominal)	NEMA Guide Shaft Tolerance	Magnet Bore MIN. (inch)	Magnet Bore MAX. (inch)
079	2 mm (.0787")		.0794	.0803
118	3 mm (.1181")		.1188	.1197
125	1/8 in (.1250")		.1257	.1266
156	5/32 in (.1563")		.1570	.1579
157	4 mm (.1575")		.1582	.1591
188	3/16 in (.1875")		.1882	.1891
197	5 mm (.1969")		.1976	.1985
236	6 mm (.2364")	+0.0000"/-0.0005"	.2371	.2380
250	1/4 in (.2500")	+0.0000 /-0.0003	.2507	.2516
276	7 mm (.2758")		.2767	.2778
313	5/16 in (.3125")		.3134	.3145
315	8 mm (.3150")		.3159	.3170
375	3/8 in (.3750")		.3759	.3770
394	10 mm (.3940")		.3949	.3960
473	12 mm (.4728")		.4737	.4748
500	1/2 in (.5000")		.5009	.5020

Other bore sizes available upon request. Contact sales@phoenixamerica.com.

Target Magnet Mounting Guidelines - Aluminum Hub (Mounting Style B)

- Proper alignment of the target magnet to the encoder sensing element is critical for optimal encoder performance. Insure that the target magnet is mounted to the specified height shown in the diagram below.
- A machined step on the motor shaft provides a quick and repeatable method for positioning the target magnet. Spacers or other fixturing should be used to properly position the target magnet if no mechanical locating features are on the shaft.
- While the hub is held in the proper position, use a .50 inch hex wrench to tighten #4-40 set screw.
- For permanent applications, a threadlocker or retaining compound is advised in conjunction with the set screw.

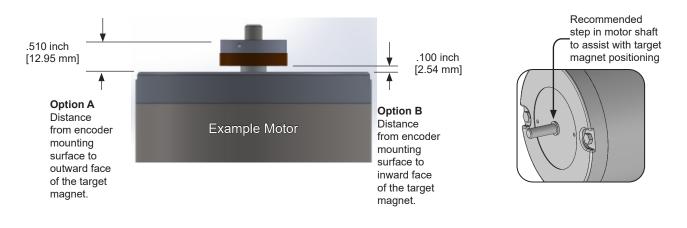


Phoenix America, LLC 4717 Clubview Drive Fort Wayne, IN 46804 T: Within USA: 1 888 801 1422 Outside USA: +1 260 432 9664 www.phoenixamerica.com sales@phoenixamerica.com © Copywrite PAL 2023, PDS DK 05/23

Subject to change without notice

H6 Series Incremental Magnetic Encoder

Target Magnet Physical Outline - Engineered Polymer Hub (Mounting Style H)

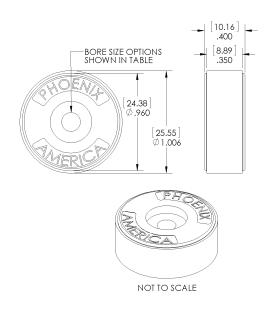

PHOENIX

ERIC

Δ Μ

Bore Size (.inch)	Motor Shaft OD Size (nominal)	NEMA Guide Shaft Tolerance	Magnet Bore MIN. (inch)	Magnet Bore MAX. (inch)
079	2 mm (.0787")		.0727	.0757
118	3 mm (.1181")		.1121	.1151
125	1/8 in (.1250")		.1190	.1220
156	5/32 in (.1563")		.1503	.1533
157	4 mm (.1575")		.1515	.1545
188	3/16 in (.1875")	+0.0000"/-0.0005"	.1815	.1845
197	5 mm (.1969")		.1909	.1939
236	6 mm (.2364")		.2304	.2334
250	1/4 in (.2500")		.2440	.2470
276	7 mm (.2758")		.2698	.2728
313	5/16 in (.3125")		.3065	.3095
315	8 mm (.3150")		.3090	.3120
375	3/8 in (.3750")		.3690	.3720
394	10 mm (.3940")		.3880	.3910

Other bore sizes available upon request. Contact sales@phoenixamerica.com.

Target Magnet Mounting Guidelines - Engineered Polymer Hub (Mounting Style H) For Press Fit Application

.06 inch [1.52 mm]

Option B

Distance

mounting

surface to

magnet.

inward face

of the target


from encoder


Table 7.1


- Proper alignment of the target magnet to the encoder sensing element is critical for optimal encoder performance. Insure that the target magnet is mounted to the specified height shown below.
- A machined step on the motor shaft provides a quick and repeatable method for positioning the target magnet. Spacers or other fixturing should be used if no mechanical locating features are on the shaft.
- A chamfered lead in on the shaft will aid in aligning the target magnet.
- Prior to insertion, the motor shaft should be clean and free of any oils, lubricants, or solvents.
- Proper fixtures and support must be used to ensure the target magnet is pressed on straight and aligned with the motor shaft.
- Opposite end of motor shaft should be supported to avoid undue stress on . motor bearings during the pressing operation.

Example Motor

In applications with high torque or environmental extremes, a retaining compound can be used to enhance the strength of the press fit.

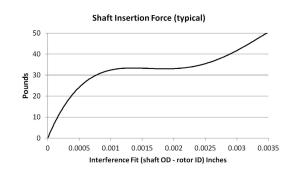

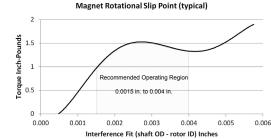



Phoenix America, LLC 4717 Clubview Drive Fort Wayne, IN 46804

.46 inch

[11.43 mm]

Option A

Distance

mounting

surface to

magnet.

from encoder

outward face

of the target

T: Within USA: 1 888 801 1422 Outside USA: +1 260 432 9664 www.phoenixamerica.com sales@phoenixamerica.com © Copywrite PAL 2023, PDS DK 05/23

Subject to change without notice


PHOENIX Α М ERIC Α

H6 Series Incremental Magnetic Encoder

Hubs

Target Magnet Physical Outline - Universal Hub (Mounting Style U)

A universal hub kit is available to accomodate both metric (2, 4, 5, 6 & 8mm) and inch (1/8, 3/16, 1/4, 5/16 & 3/8 In.) industry standard shaft diameters.

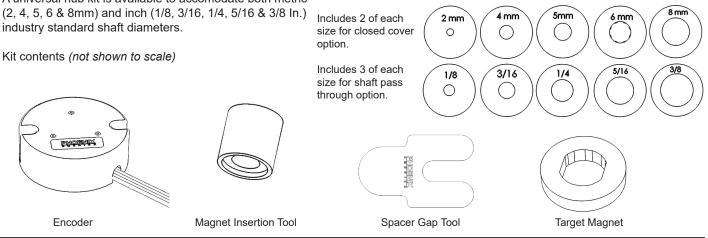

Without shaft pass-through option

Assembly Guidelines

			1 5 1	
Step 1	Step 2	I	Step 3	Step 4
Attach two of the desired hub size on each side of the magenet. Make sure the flats are in-line with each other.	Use the insertion tool to push the magnet assembly straight onto the shaft until the bottom face		Place the encoder onto the motor and secure with #2 or M2 screws.	Manually spin the shaft to verify that the shaft/magnet is not interfering with the encoder.
	of the hub is resting on the gap tool. <i>tip</i> - Support the bottom of the motor with a fixture or holding clamp.			Encoder Cross Section - note the magnet assembly and shaft are not in contact with the encoder housing or the motor housing.
With shaft pass- through option Step 2a Insert an additiona piece as shown. T is used as a fill-sp to match the open the encoder housi	al hub This acer ing in	PI. en the se	ep 3a ace the icoder onto e motor and icure with #2 M2 screws.	Fractional Constraints Encoder Cross Section - note the top face of the filler hub should be slightly below the top face of the encoder housing as shown by the arrow pointer.


Phoenix America, LLC 4717 Clubview Drive Fort Wayne, IN 46804

T: Within USA: 1 888 801 1422 Outside USA: +1 260 432 9664 www.phoenixamerica.com sales@phoenixamerica.com © Copywrite PAL 2023, PDS DK 05/23

PHOENIX


Wiring (Single ended option depicted)

Table 9.1

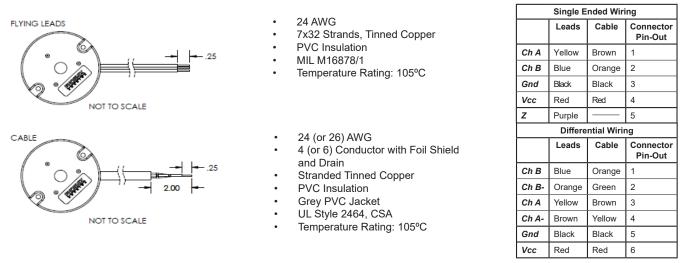


Custom lengths and insulation materials available. Contact sales@phoenixamerica.com.

Connector Options (Single ended option depicted)

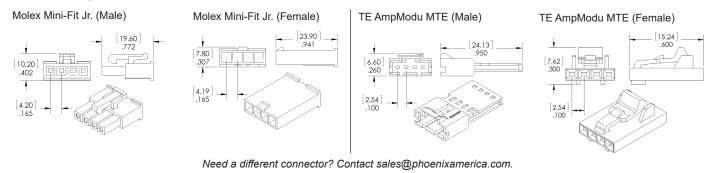

Part Number Description

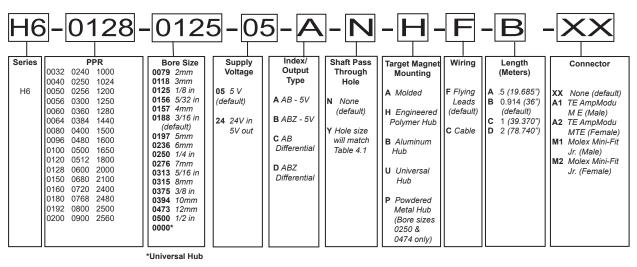

Example: H6-0128-0125-05-A-N-H-F-B-X

Phoenix America, LLC 4717 Clubview Drive Fort Wayne, IN 46804 T: Within USA: 1 888 801 1422 Outside USA: +1 260 432 9664 www.phoenixamerica.com sales@phoenixamerica.com © Copywrite PAL 2023, PDS DK 05/23